


WOCA Driftwood Lye

– For colour pre treatment of untreated oak wood

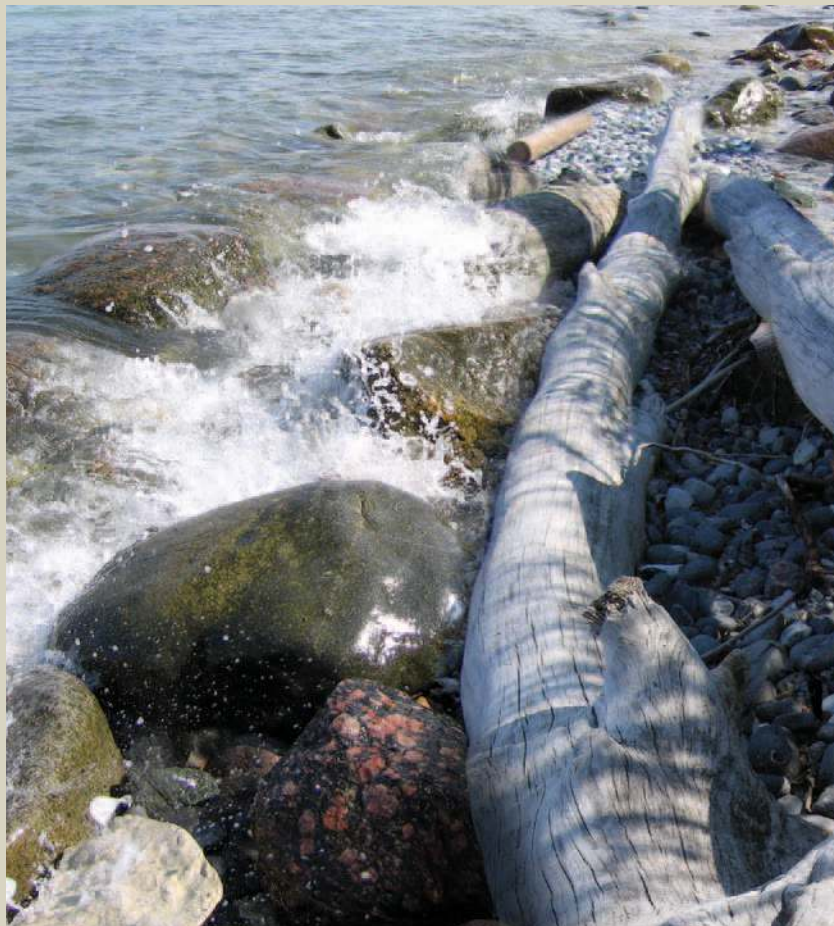

- Gives oak a weather-beaten patina
- Requires additional treatment with oil
- Water based
- Only suitable for Oak wood
- Certified by IBR

Product info

Container: 2,5L

Consumption: 8-10 m²/L
depending on the wood type



Application area

The product is primarily for oak wood. By using this product, the wood will get a unique 2-dimensional appearance. Finally, the surface must be treated with one of the WOCA oils.

Result

WOCA Driftwood Lye is a uniform product, which gives the wood a weather-beaten patina.

Application

Apply the lye in an even coat and undiluted with a lye-resistant brush or paint roller along the grain of the wood, at least 1 litre for 10 m².

After care

Finally, the surface must be treated with one of the WOCA oils.

Maintaining and cleaning

According to the chosen finishing treatment.

How to do...

– WOCA Driftwood Lye



Easy and effective. *Naturally*

Tools

Lye-resistant brush or paint roller.

Clean tools with water and soap.

WOCA Driftwood Lye is a unique product, which gives the wood a weather-beaten patina. The product is primarily for oak wood. By using this product, the wood will get an attractive 2-dimensional design. Finally, the surface must be treated with one of the WOCA oils. The product is water-based.

- 1** For application use suitable safety gloves and -glasses.
- 2** The surface needs light sanding and must be clean and dry. We recommend a full sanding with grit 100-120. Please note that the sanding, as far as possible, must take place immediately before the application of the lye.
- 3** Shake the container well and pour the lye into a plastic paint tray. Make sure there are no pigments left in the container. During the process, the lye must be stirred.
- 4** Apply the lye in an even coat and undiluted with a lye-resistant brush or paint roller along the grain of the wood, at least 1 litre for 10 m².

- 5** As a rule, the wood is dry after 24 hours at 20°C. After complete drying, use a polishing machine with either a beige/8mm green or bordeaux pad for denibbing. Subsequently, remove the sanding dust with vacuum cleaner. Basic treatment with one of the well-known WOCA oils.